
Erosion Control Blanket Installation Guide

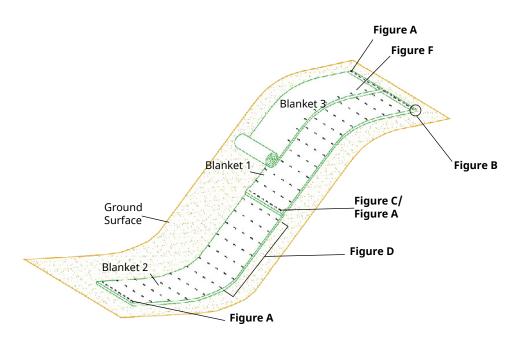

*Drawings Not to Scale

Step 1: Site Preparation

Prepare site to design profile and grade. Remove debris, rocks, clods, etc. Ground surface should be smooth prior to installation to ensure blanket remains in contact with slope.

Step 2: Seeding

Seeding of site should be conducted to design requirements or to follow local or state seeding requirements as necessary.


Step 3: Staple Selection

At a minimum, 6" (150 mm) long by 1" (25 mm) crown, 11 gauge staples are to be used to secure the blanket to the ground surface. Installation in rocky, sandy or other loose soil may require longer staples.



Step 4: Excavate Anchor Trench and Secure Blanket

Excavate a trench along the top of the slope to secure the upstream end of the blanket. The trench should run along the length of the installation, be 6" (150 mm) wide and 6" (150 mm) deep. Staple blanket along bottom of trench, fill with compacted soil, overlap blanket towards toe of slope and secure with row of staples (shown in Figures A and B).

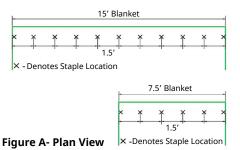

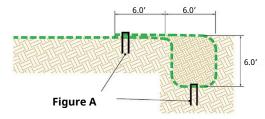


Figure B- Profile View

Step 5: Secure Body of Blanket

Roll blanket down slope from anchor trench. Staple body of blanket following the pattern shown in Figure D. Leave end of blanket unstapled to all for overlap shown in Figure C. Place downstream blanket underneath upsteram blanket to form shingle pattern. Staple seam as shown in Figure A. Secure downstream blanket with stapling pattern shown in Figure D. Stapling pattern shown in Figure D reflects minimum staples to be used. More staples may be required to ensure blanket is sufficiently secured to resist mowers and foot traffic and to ensure blanket is in contact with soil surface over the entire area of blanket. Further, critical points require additional staples. Critical points are identified in Figure E.

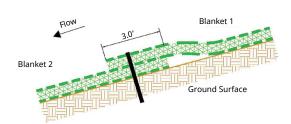


Figure C- Profile View

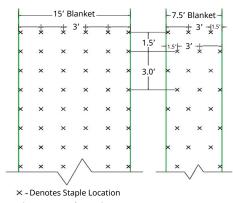


Figure D- Plan View

Step 6: Continue Along Slope - Complete Installation

Overlap adjacent blankets as shown in Figure F and Repeat Step 5. Secure toe of slope using stapling pattern shown in Figure A. Secure edges of installation by stapling at 18" (450 mm) intervals along the terminal edge.

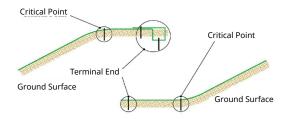


Figure E- Critical Point Securing

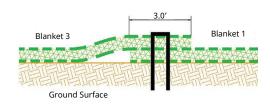


Figure F- Cross Section View

